
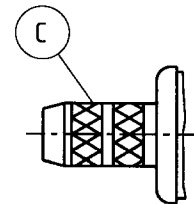
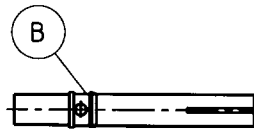


Assembly instruction Series TNC No. 27221

Tools and materials required :	Straight connectors for flexible cable	
	Cable entry : SUHNER Full - Crimp	
Stanley blade Scissors Crimp tool (see table below)	Connector types : (e.g.)	
	24 TNC - 50 - 3 - 21	
This connector is supplied in 3 parts	Suitable cables e.g. :	RG 223 / U
	Centre contact :	cavity 2
	Braid :	cavity B
	Crimp tool :	2B (orange)

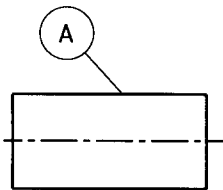

	<p>Slide ferrule A onto cable. Prepare cable according to diagram. CAUTION : Do not damage braid, dielectric and inner conductor of cable !</p>
	<p>Push contact B over inner conductor of cable to abut dielectric and crimp.</p>
	<p>Splay out braid and insert cable in connector body C. Ensure that braid lies above the crimp neck.</p>
	<p>Slide ferrule A over braid and crimp as close to connector body C as possible.</p>

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices ! Please contact our representative for further details of this service



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text : siehe Rückseite