


Cable entry screw type

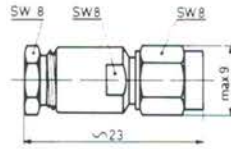


SUHNER TYPE Gold / CuBe	SUHNER TYPE Stainless Steel	SUHNER TYPE Economic ¹⁾	Ident. No.	Cable group (example)	MIL Type M 39012/	AI	Weight	SWR
11SMA-50-3-7c			640050	U7 (RG 58C/U)		3071	6 g	D
11SMA-50-3-8c			640051	(RG 223/U)		3071	6 g	D
11SMA-50-3-10c			640053	(RG 400/U)		3071	6 g	D

Right Angle Plugs

Cable entry CRIMP

Taper sleeves see page 214

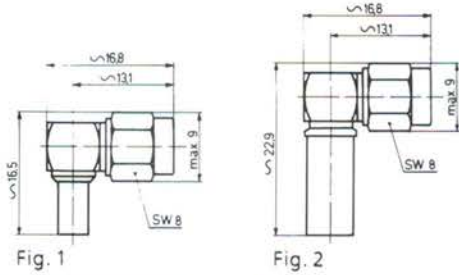


SUHNER TYPE Gold / CuBe	SUHNER TYPE Stainless Steel	SUHNER TYPE Economic ¹⁾	Ident. No.	Cable group (example)	CECC Approval 22111-	MIL Type M 39012/	Crimp insert	Weight	Fig.	SWR
16SMA-50-2-5c			640071	U2 (RG 316/U)	810-01	56-4112	A	5 g	1	G
	16SMA-50-2-55c		642661	U2 (RG 316/U)			A	5 g	1	G
		16SMA-50-2-45c	642244	U2 (RG 316/U)			A	5 g	1	G
16SMA-50-2-6c			640072	U4 (KO2252d)			A	5 g	1	G
	16SMA-50-2-56c		642662	U4 (KO2252d)			A	5 g	1	G
		16SMA-50-2-41c	641322	U4 (KO2252d)			A	5 g	1	G
16SMA-50-3-5c			640074	U7 (RG 58C/U)	810-03	56-4114	B	6 g	2	F
	16SMA-50-3-55c		642659	U7 (RG 58C/U)			B	6 g	2	F
		16SMA-50-3-45c	642240	U7 (RG 58C/U)			B	6 g	2	F
16SMA-50-3-6c			640075	U9/11 (RG 400/U)	810-05	56-4115 56-4116	B	6 g	2	F
	16SMA-50-3-56c		642660	U9/11 (RG 400/U)			B	6 g	2	F
		16SMA-50-3-46c	641199	U9/11 (RG 400/U)			B	6 g	2	F

AI-No. 3070

Cable Jacks

Cable entry CRIMP

Taper sleeves see page 214

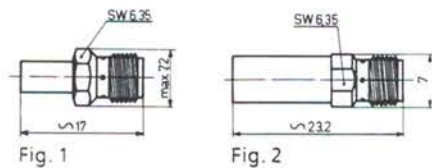

SUHNER TYPE Gold / CuBe	SUHNER TYPE Stainless Steel	SUHNER TYPE Economic ¹⁾	Ident. No.	Cable group (example)	MIL Type M 39012/	Crimp insert	Weight	Fig.	SWR
21SMA-50-2-5c			640077	U2 (RG 316/U)	57-4019	A	2 g	1	E
21SMA-50-2-6c			640078	U4 (KO2252d)		A	2 g	1	E
21SMA-50-3-5c			640081	U7 (RG 58C/U)	57-4021	B	3 g	2	D
21SMA-50-3-6c			640082	U9/11 (RG 400/U)	57-4022 57-4023	B	3 g	2	D

AI-No. 3069

1) Use torque wrench SUHNER type 74Z-0-0-79
AI = Assembly instructions
Cable groups see page 9

SWR groups see page 45
Assembly tools see page 205
Mounting holes see page 219

VSWR Diagram

